

Wide Band PA Series

0/E CONVERTER



<u>Mode l</u>

SPA-3 SPA-4

Graviton INC

http://www.graviton.co.jp/english/index.htm


Page 1

Contents of this package


The contents of this package are listed below.

Please contact immediately the shop you purchased this product, if there is any missing item s found.





4 User's Manual (this manual)



- ① 0/E converter
- 2 Power Cable Assembly
- 3 Auxiliary Power Connector

♦Please keep original packaging, in case of re-shipping.

Introduction

Thank you for purchasing PA Series O/E Converter.

PD Series is Optical to Electric signal converter and has following feature.

- · Wide Frequency Range

DC \sim 2000MHz Flatness +0.5 -3.0[dB electrical] SPA-3

- DC \sim 3000MHz Flatness +0.5 -3.0[dB electrical] SPA-4 Standard FC optical connector
- (Optional SC, F05, SMA, and ST connector are also available.)

 Standard BNC plug
- Able to connect directly to an oscilloscope, a spectrum analyzer etc.
- Able to get DC power from instruments through included Power Cable Assembly. It is not guaranteed that power cable corresponds to all instruments.
- Able to use for instrumentation of lightwave products, optical links or other various applications.

Please read this user's manual carefully and use it appropriately according to this manual, will make this product useful for development of light wave equipments, lightwave communication converter or other various applications.

- ◇Do not re-produce or re-publishing a part or all this manual without written permission from Graviton Inc.
- ♦This manual is subject to change without notice.
- ♦Please follow exporting regulations/rules in individual countries when exporting this product to other countries.

Page 2

Front and rear panel view



① Power switch

This switch is for controlling power. Please on/off this switch after connecting power cable assembly to power connector(②) also keep this switch off when not in use.

2 Power input connector


The power can be supplied from probe power connector that equipped with an instrument through the Power Cable Assembly. Or, alternately, external regulated power supply (not included) can be used through the Auxiliary Power Connector. Power supply voltage for PD series is ±15[V]. Applying over and/or wrong polarity may cause permanent damage. Please refer the specification in page 7 for current consumption and page 5 for the detail of the power connection.

③ Optical signal input connector

Light signal supplied through this FC connector is up to -1[dBm] for SPA-3 and up to +1[dBm] for SPA-4. Please do not apply 10dBm or higher light signal. It may cause permanent damage.

4 Electrical signal output connector

 $50[\Omega]$ input impedance with wide frequency range instruments is suitable to observe light signal. Recommended to use wider frequency range instruments to withdraw full spec. (DC~2000MHz SPA-3, DC~3000MHz SPA-4)

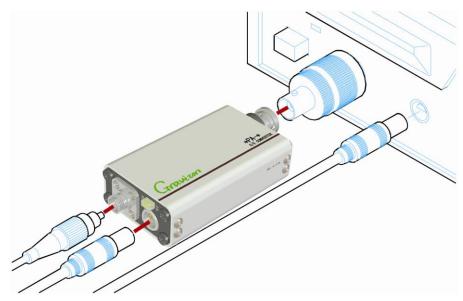

- 1. First of all, connect the O/E converter to input connector of an instrument. Conversion connector may be required, if the instrument has no BNC jack.
- 2. Confirm power switch on the O/E converter is off then connect Power Cable Assembly supplied. Other side of the Power Cable can be connected to the instrument, if probe power connector is equipped. Please refer page 6 for connecting external power supply, if the instrument has no probe power connector.
- 3. Turn on the power switch.
- 4. Connect fiber connector to the 0/E converter and adjust voltage and sweep time of the instrument observe the light signal. Also make sure $50[\Omega]$ impedance is selected on the instrument.

Page 5

Specifications


Item	Test Condition		SPA-3	SPA-4
OE Device			Si PIN PD	Si PIN PD
Peak Sensitivity Wavelength			700nm	700nm
Wavelength Range	More than 1/5		380nm ∼	380nm ∼
	of peak sens.		950nm	950nm
Conversion Gain	50GI Fiber		500mV/mW	300mV/mW
			@850nm	@850nm
Acceptable Core Diameter		Less than		Less than
			0. 25mm	O. 25mm
Acceptable Fiber NA			Less than	Less than
			0. 5	0. 5
Frequency Bandwidth	-3dB electrical		DC∼2. OGHz	DC∼3. OGHz
Maximum Optical Power for	400mV Out		−1dBm	+1dBm
Proper Signal Output		@850nm		@850nm
Wideband Noise Voltage	Up to 12.4GHz		Less than	Less than
			1.5mVrms	1.8mVrms
Noise Equivalent Power	850nm		Less than	Less than
			-25. 2dBm	−22. 4dBm
Output Offset Voltage	No Input Signal		Within	Within
			+/- 0.5mV	+/- 0.5mV
Output Impedance			50ohms	50ohms
Input Optical Connector			FC	FC
Output Coax Connector			BNC Plug	BNC Plug
Supply Voltage			+/-15V DC	+/-15V DC
Supply Current			+150mA/-50n	mA +150mA/-50mA
Physical Dimension[mm]			103x44x21	103x44x21
Weight[g]			130	130
Operational Temperature +5[°C]]~+35[°C]	Storage temp	erature -20	[°C]~+50[°C]

(This specifications are subject to change without notice.)


Connecting External Power Supply

1. An external power supply is necessary, if an instrument going to use has no probe power output. The requirements for the power supply are regulated ±15[V] ±5[%] and capable of supplying more than 150[mA] current with low ripple and noise. And connect as following figure.

Wrong power supply connection may cause permanent damage on the O/E converter. Please make sure the connection as RED Cable for Positive terminal, Black Cable for Ground Terminal and Blue Cable for Negative Terminal.

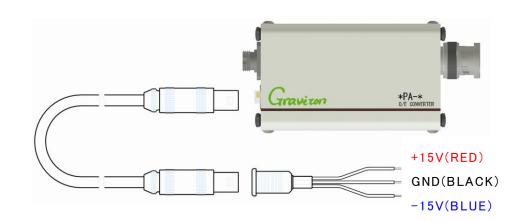


2. Panel cutout size is as following to mount the Auxiliary Power Connecter on a panel, if necessary. Maximum allowable thickness of the panel is 5mm.

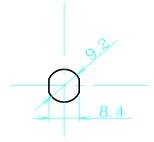

Page 6

The Spectral Sensitivity curve of SPA-3 & SPA-4

(Reference point is 1 at 850nm)

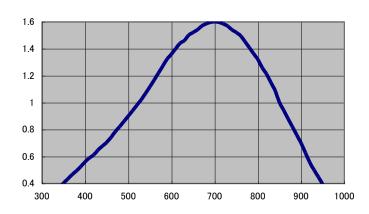

Wave Length [nm]

Contact to: Graviton Inc.

1-8-1 Kasuga-cho, IRUMA-SHI, SAITAMA, 358-0006 JAPAN

TEL: +81-4-2966-0816 FAX: +81-4-2966-0817

"GRAVITON" is trade mark of Graviton Inc. in Japan.

Copyright 2006 by Graviton Inc. All right reserved.

Never reproduce or republish without written permission.